## Step 5

Find the CAN connection on the machine: It is located near the fuse panel on the right side of the driver's  $% \left( \frac{1}{2}\right) =\left( \frac{1}{2}\right) \left( \frac{1}{2}\right)$ seat.



Step 6 Remove the access panel.



## Step 7

Find the BUS extension connectors: They are toward the bottom right of the fuse panel.

**Note** – This is an approximate position only. You may need to push some harnesses out of the way to gain access.



## Step 8

The connectors are labeled **BUS EXTENSION**. Disconnect them and then insert the Trimble CAN jumper cable in between.



## Step 9

Connect the other end of the Trimble CAN cable to the NavController II harness. Plug connector P4A on P/N 56850 into P12 **Lightbar/Spare** on P/N 54602. Do not plug it into P4 **Display** on P/N 54601.

