

# Support Bulletin

AGRICULTURE


August 2022

TRIMBLE RESELLER CONFIDENTIAL

## Autopilot Automated Steering System: *Direction Estimator not initialized* Error Message

### Problem Description

An Autopilot™ issue has been reported of an error message appearing on the Precision-IQ™ Run screen:

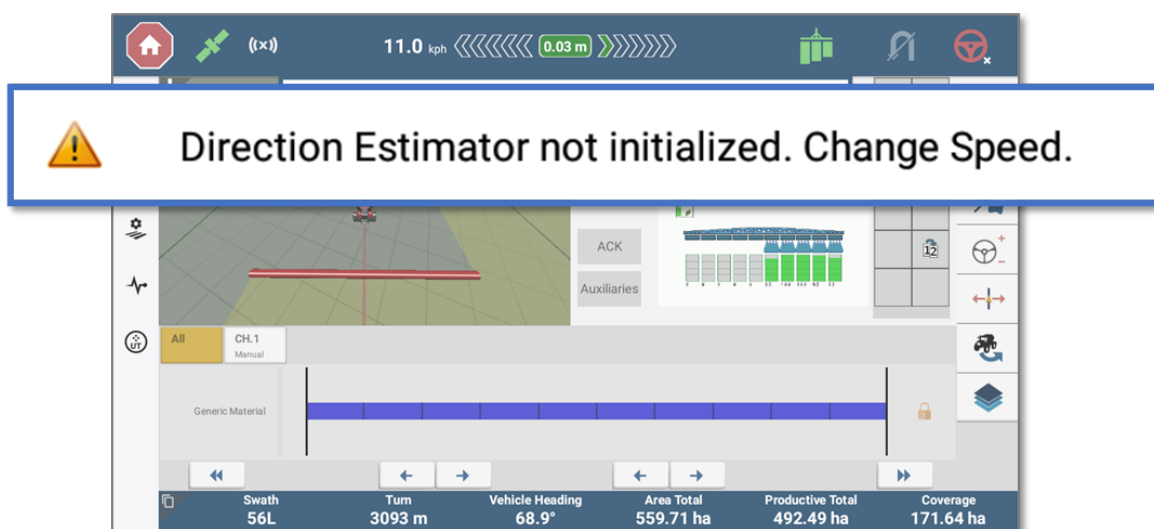

This *Direction Estimator not initialized. Change Speed* message seems to affect Autopilot users with the following configurations:

Display	Receiver	Firmware Version
GFX-750™	NAV-900, NavController III	v11.24

A possible cause of this problem, which is currently being investigated, is the movement of the machine on rough ground. As a result, GPS acceleration becomes unstable.

<http://agpartners.trimble.com>

## Problem Resolution

Contact [Trimble Ag Support](#) for NavController III firmware version 13.75.**91.4** to resolve this issue.

**Note:** The NAV-900 guidance controller does not support NavController II units. See [NavController II: End-of-Service-Life \(EOSL\)](#).

## For More Information

Contact local Trimble Ag Support: [Ag\\_Support@Trimble.com](mailto:Ag_Support@Trimble.com)